

ornl

**OAK RIDGE
NATIONAL
LABORATORY**

MARTIN MARIETTA


ORNL/TM-11500



3 4456 0349253 9

**Bulk Shielding Facility
Quarterly Report
October, November, and December 1989**

D. L. Laughlin
T. P. Hamrick

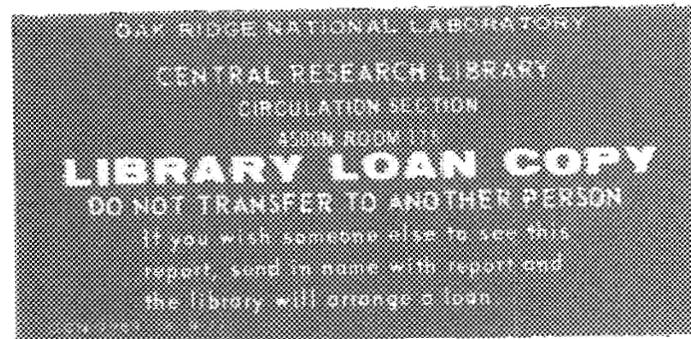

OPERATED BY
MARTIN MARIETTA ENERGY SYSTEMS, INC.
FOR THE UNITED STATES
DEPARTMENT OF ENERGY

This report has been reproduced directly from the best available copy.

Available to DOE and DOE contractors from the Office of Scientific and Technical Information, P.O. Box 62, Oak Ridge, TN 37831; prices available from (615) 576-8401, FTS 626 8401.

Available to the public from the National Technical Information Service, U.S. Department of Commerce, 5285 Port Royal Rd., Springfield, VA 22161.

NTIS price codes--Printed Copy: A03 Microfiche A01

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

Research Reactors Division
"B" Reactors Section

**BULK SHIELDING FACILITY QUARTERLY REPORT
OCTOBER, NOVEMBER, AND DECEMBER 1989**


D. L. Laughlin
T. P. Hamrick

SPONSOR: H. A. Glover
Research Reactors Division

Date Published: June 1990

Notice: This document contains information of a preliminary nature. It is subject to revision or correction and, therefore, does not represent a final report.

Prepared by the
Oak Ridge National Laboratory
Oak Ridge, Tennessee 37831
operated by
MARTIN MARIETTA ENERGY SYSTEMS, INC.,
for the
U.S. DEPARTMENT OF ENERGY
under Contract DE-AC05-84OR21400

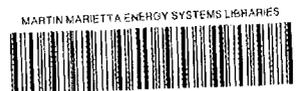

3 4456 0349253 9

CONTENTS

	Page
ACRONYMS	iv
LIST OF FIGURES	v
LIST OF TABLES	v
SUMMARY	1
BULK SHIELDING FACILITY	1
OPERATIONS	1
Shutdowns	1
Maintenance and Changes	1
Operational Activities	1
Experiments	1
Fuel	7
Experiment Facilities Assignments	8
Gas Filter Status	8
SUMMARY OF SURVEILLANCE TEST AT THE BSR	8
POOL CRITICAL ASSEMBLY	13
OPERATIONS	13
SURVEILLANCE TESTS AT THE PCA	13

ACRONYMS

BG	background
BSR	Bulk Shielding Reactor
CAM	constant air monitor
DOE	Department of Energy
DOP	dioctylphthalate
dP	difference of pressure
dT	difference of temperature
FR&CAS	Facility Radiation and Contamination Alarm System
HEPA	high-efficiency particulate, air
HEU	high-enriched uranium
I&C	Instrumentation and Controls Division
LEW	low-enriched uranium
LTNIF	Low-Temperature Neutron Irradiation Facility
NOG	normal off-gas
P&E	Plant and Equipment Division
PCA	Pool Critical Assembly
RORC	Reactor Operations Review Committee

LIST OF FIGURES

	Page
1 BSR core	2

LIST OF TABLES

Table	Page
1 Basic operating data (October-December 1989)	3
2 Analysis of shutdowns	3
3 Maintenance and changes - instrumentation and controls	4
4 Maintenance and changes - process system	5
5 Maintenance and changes - mechanical system	5
6 Operational activities	6
7 Fuel and shim-safety rod status	7
8 Experiment facilities assignments	8
9 Gas filter status	9
10 Summary of surveillance tests at the BSR	10

BULK SHIELDING FACILITY QUARTERLY REPORT OCTOBER, NOVEMBER AND DECEMBER 1989

SUMMARY

The Bulk Shielding Reactor (BSR) remained shut down during October, November, and December. Water-quality control in both the reactor primary and secondary cooling systems was satisfactory.

The Pool Critical Assembly (PCA) is shut down for shim-safety rod magnets and associated electronic components upgrading.

BULK SHIELDING FACILITY

OPERATIONS

The BSR core is shown in Fig. 1. However, the shim-safety rod calibrations are not complete because of a reactor shutdown ordered by the Department of Energy (DOE) on March 26, 1987.

The BSR remained down during the quarter as ordered by the DOE. The basic operating data are shown in Table 1.

Shutdowns

The reactor remained shut down during the quarter. Table 2 gives an analysis of the scheduled and unscheduled shutdowns.

Maintenance and Changes

Maintenance and changes to the instrumentation components in the complex are listed in Table 3.

Maintenance and changes of the process systems are listed in Table 4.


Maintenance and changes of the mechanical systems are listed in Table 5.

Operational Activities

The operational activities for the quarter are listed in Table 6.

Experiments

There was no work relating to the Low-Temperature Neutron Irradiation Facility (LTNIF).

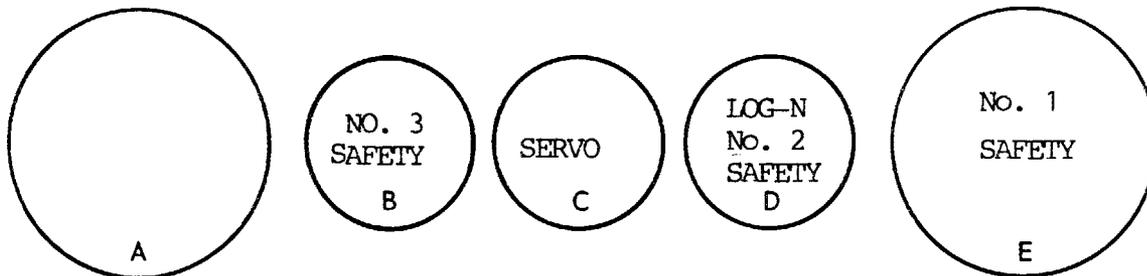

ORNL/DWG 89-7898

BSR CORE



				(C)	AL	AL	AL	AL
81	82	83	84	85	86	87	88	89
				AL	AL	AL	AL	AL
71	72	73	74	75	76	77	78	79
	EAST				BSF-S-17 63		BSF-S-18 64	
61	62	63	64	65	66	67	68	69
	D ₂ O							
51	52	53	54	55	56	57	58	59
	TANK			BSF-S-T2 107		BSF-S-T4 107		(a)
41	42	43	44	45	46	47	48	49
31	32	33	34	35	36	37	38	39
					BSF-S-T1 83		BSF-S-T3 83	
21	22	23	24	25	26	27	28	29
11	12	13	14	15	16	17	18	19

LOADING NO.

DATE

November 16, 1988

EXCESS REACTIVITY

(b)

OPERATING MASS

507g

ROD POSITIONS AT CRITICAL
(With Operating Mass)

ROD NO.	IN. WITHDRAWN
1	
2	
3	
4	
5	
6	

REMARKS:

DOE mandated reactor to be shutdown 4 p.m., March 26, 1987

(a) Core position for the Low-Temperature Neutron Irradiation Facility.

(b) Rod calibrations are not complete due to a DOE mandated reactor shutdown on March 26, 1987.

(c) Fission chamber.

Fig. 1 BSR Core

Table 1. Basic operating data
(October-December 1989)

	This quarter	Last quarter	Year to date
Total energy, kWd	0	0	0
Average operating power, kW	0	0	0
Time operating, %	0	0	0
Reactor availability, %	99.9	99.9	99.9
Reactor water radioactivity, cpm/mL (av)	BG	BG	BG
Reactor water resistivity, ohm-cm (av)	731,999	753,000	749,558
Research samples	0	0	0

Table 2. Analysis of shutdowns*

Description of shutdown	Number
Scheduled	0
Unscheduled	0
Total	0

*The Department of Energy ordered the reactor to be shut down on March 26, 1987. The reactor did not operate during the report period.

Table 3. Maintenance and changes - instrumentation and controls

Date	Components	Trouble/change	Maintenance performed
10/4/89	NW CAM	Inoperative	I&C repaired and returned to service.
10/11/89	3010 building		I&C checked sound levels of the evacuation horn.
10/19/89	FR&CAS	Routine	I&C performed quarterly check.
10/30/89	CAMs	Routine	I&C changed charts.
11/1/89	Surveillance cameras	Routine	I&C checked camera operation.
11/7/89	LMB 105	Inoperative	I&C retubed.
12/7/89	Quarterly checks	Routine	I&C completed fourth quarter surveillance functional tests.
12/18/89	FR&CAS	Routine	I&C performed bimonthly check.
12/28/89	CAMs	Routine	I&C replaced charts.

Table 4. Maintenance and changes - process systems

Date	Component	Trouble/change	Maintenance performed
10/10/89	7-½-ton crane	Routine	QA&I inspected and installed inspection sticker.
10/23/89	Truck doors and ¼-ton hoist	Routine	P&E performed programmed maintenance
10/24/89	3009 steam regulator	Stuck diaphragm	P&E repaired.
11/10/89	Mobile catwalk	Routine	P&E performed programmed maintenance.
11/22/89	Pumps and valves	Routine	P&E performed programmed maintenance on demineralizer pump, primary pump, and secondary control valve.
11/27/89	Pumps and fan	Routine	P&E performed programmed maintenance on secondary pump, air conditioner pump, two acid pumps, and N&S tower fan motors.
12/4/89	Control room lights	Burned out	P&E relamped control room.
12/7/89	CAMs	Routine	P&E performed programmed maintenance on building CAMs.
12/27/89	Steam tracing	Leaking	P&E repaired BSR secondary pump steam tracing.

Table 5. Maintenance and changes - mechanical systems

Date	Components	Trouble/change	Maintenance performed
	None	None	None

Table 6. Operational activities

Date	Remarks
10/1/89	Replaced nitrogen cylinder for evacuation horn.
10/19/89	Opened secondary tower bypass valve for cold weather operation.
10/24/89	Health Physics installed calibrated probe on LMB 105 in control room.
11/1/89	Operated mobile catwalk bridge for I&C to check surveillance cameras.
11/8/89	RORC reviewed BSR complex.
11/15/89	Health Physics calibrated building CAMs.
12/6/89	Health Physics calibrated building monitrons.
12/7/89	Performed containment system quarterly functional checks.
12/31/89	Sampled secondary water system once a month and sent to Industrial Hygiene for <i>Legionella</i> analysis.
12/31/89	Water quality during the quarter: inlet resistivity ohm-cm 731,999 and water radioactivity c/m/mL BG.

Fuel

Changes in the fuel inventory are reported in Table 7.

Table 7. Fuel and shim-safety rod status

	This quarter	Last quarter	Year to date
Fuel elements depleted	0	0	0
Shim-safety rod fuel elements depleted	0	0	0
New fuel elements placed in service	0	0	0
New shim-safety rod fuel elements placed in service	0	0	0
Partially depleted shim-safety rod fuel elements (HEU)	6	6	6
Partially depleted shim-safety rod fuel elements (HEU) for PCA	4	4	4
New fuel elements (HEU) available for use	15	15	15
New shim-safety rod fuel elements (HEU) available	7	7	7
Partially depleted fuel elements (HEU) available for use	30	30	30
Partially depleted fuel elements (LEU) for PCA	32	32	32
Partially depleted fuel elements (HEU) for PCA	1	1	1
New boron stainless steel shim-safety rods placed in service	0	0	0
Boron stainless steel shim-safety rods in service	6	6	6
Boron stainless steel shim-safety rods available for use	1	1	1

Experiment Facilities Assignments

Experiment facilities assignments are listed in Table 8. The tubes of the east D₂O tank are not permanently assigned; they have been used by various Laboratory personnel for short-term sample irradiations.

Table 8. Experiment facilities assignments

Facility	Location	Division or sponsor
Dry thermal-neutron tubes (D-3-1 and -2)	East D ₂ O tank	Research Reactors
Wet thermal-neutron tubes (D-4-1 and -2, D-6-1, -2, -3, -4 and -5)	East D ₂ O tank	Research Reactors
Low-Temperature Neutron Irradiation Facility (LTNIF)	Southwest corner of pool	Solid State

Gas Filter Status

Table 9 gives detailed information on the condition of both the cell vent and NOG filters.

SUMMARY OF SURVEILLANCE TESTS AT THE BSR

Table 10 is a tabulation of the completion dates of the surveillance tests required by the Technical Specifications. This table contains all the surveillance tests scheduled for frequencies of one test per month or longer. Other surveillance requirements that are not reported are satisfied by routine completion of daily and weekly check sheets, startup checklists, hourly data sheets, the operating log book, and miscellaneous quality assurance tests.

Table 9. Gas filter status

Filter system	Type filter	Bank designation	Filter segment	Date changed	Date of last test	Date of previous test	Type test	Efficiency (%)
Cell vent	HEPA	North (5857)	East West	9/17/89 8/17/83	12/1/89	6/20/89	DOP	99.996
Cell vent	HEPA	Center (5858)	East West	9/17/85 8/17/83	12/1/89	6/20/89	DOP	99.996
Cell vent	HEPA	South (5859)	East West	9/17/85 8/17/83	12/1/89	6/20/89	DOP	99.997
Cell vent	Charcoal	North (612)	Overall	10/8/87	7/27/88	1/6/88	Iodine	98.635
Cell vent	Charcoal	Center (613)	Overall	10/8/87	7/27/88	1/6/88	Iodine	98.652
Cell vent	Charcoal	South (614)	Overall	10/8/87	7/27/88	1/6/88	Iodine	99.184
NOG	HEPA	East (5650)	Overall	1/27/89	9/13/89	3/16/89	DOP	99.998
NOG	HEPA	West (5651)	Overall	1/27/89	9/13/89	3/16/89	DOP	99.998
NOG	Charcoal	East (610)	Overall	1/27/89	2/1/89	6/23/88	Iodine	99.883
NOG	Charcoal	West (609)	Overall	1/27/89	1/31/89	12/29/89	Iodine	99.900

Table 10. Summary of surveillance tests at the BSR

Test	Most recent test	Previous test
<i>Biennial tests</i>		
Inspection of the shim-safety rods	1/22/87 ^a	9/23/85 ^a
<i>Annual tests</i>		
Core dT channel calibration	9/27/88 ^a	9/25/87
Core dP channel calibration	9/28/88 ^a	9/30/87
Primary coolant flow channel calibration	9/28/88 ^a	9/30/87
Pool water-level channel calibration	9/29/88 ^a	9/30/87
Maximum rate of reactivity addition by the shim-safety rods	3/26/87 ^b	12/16/86 ^b
Reactivity assigned to the servo-control system	3/26/87 ^b	5/2/86 ^b
Subcriticality with each shim-safety rod at its upper limit while all other shim-safety rods are fully inserted	9/22/88	6/13/88
<i>Semiannual</i>		
Cell ventilation filters		
HEPA filters:		
North	12/1/89	6/20/89
Center	12/1/89	6/20/89
South	12/1/89	6/20/89
Charcoal filters:		
North	7/27/88 ^a	1/6/88
Center	7/27/88 ^a	1/6/88
South	7/27/88 ^a	1/6/88
Continuous air monitor	11/15/89	8/11/89
Radiation monitor	12/6/89	9/6/89
Stack radiation monitor calibration	12/1/89	7/10/89

Table 10. (continued)

Test	Most recent test	Previous test
<i>Semiannual (continued)</i>		
NOG filter system efficiency		
Elemental iodine test - east bank	2/1/89 ^a	6/23/88
Elemental iodine test - west bank	1/31/89 ^a	12/19/88
Diocetyl phthalate test - east bank	9/13/89	3/16/89
Diocetyl phthalate test - west bank	9/13/89	3/16/89
<i>Quarterly</i>		
Safety channel No. 1 calibration	9/19/88 ^a	6/7/88
Safety channel No. 2 calibration	9/20/88 ^a	6/7/88
Safety channel No. 3 calibration	9/20/88 ^a	6/7/88
Log-N channel calibration	9/19/88 ^a	6/7/88
Fission chamber channel calibration	9/22/88 ^c	5/26/88 ^c
Flapper valve position channel functional test	9/29/88 ^a	6/14/88
Measurement of release time and time of flights for the shim-safety rods	9/22/88 ^a	6/13/88
Containment closure system functional test	12/7/89	9/29/89
Inleakage during containment mode	12/7/89	9/29/89
<i>Ten-year</i>		
Siphon break system functional test	7/17/86	3/11/82
Reactor containment inspection	9/22/83	1/3/75

Table 10. (Continued)

Test	Most recent test	Previous test
<i>Ten-year (continued)</i>		
Support structure inspection	9/22/83	1/3/75
Reactor bridge inspection	8/30/85	10/12/72
Primary piping (in-pool) inspection	6/16/87	1/3/75
Primary piping (pump house) inspection	9/4/85	10/12/72
Primary piping (valve pit) inspection	8/26/85	10/12/72
Primary pump (when accessible) inspection	3/19/81	5/5/80
<i>Others</i>		
Calibration of shim-safety rods	3/26/87 ^b	5/2/86
Emergency electrical power test	9/28/88 ^a	7/12/88
LTNIF, pool water level, functional test	6/23/88 ^a	6/5/87
Flying bridge structure inspection	1/27/88	
Work platforms (southeast and southwest) structure inspection	1/27/88	
BSR heat exchanger internal inspection	5/13/87 ^a	

^aThese items will be checked prior to startup.

^bRod calibrations are not complete because of the DOE-ordered shutdown on March 26, 1987.

^cCounts were not sufficient to make a calibration check. This will be done prior to reactor startup.

POOL CRITICAL ASSEMBLY

OPERATIONS

The PCA is shut down for shim-safety rod magnets and associated electronic components to be upgraded.

SURVEILLANCE TESTS AT THE PCA

Shim-safety rod magnets and associated electronic components are being upgraded at the PCA. Until this work is completed, it will not be possible to make all the surveillance tests required at this facility by the Technical Specifications. Thus, a waiver of the PCA Technical Specifications surveillance test requirements during the proposed modification and component replacement period was granted.¹

¹Letter to B. L. Corbett from K. H. Poteet, subject "Waiver of Surveillance Tests at the PCA," March 26, 1985.

INTERNAL DISTRIBUTION

- | | |
|-----------------------|--------------------------------------|
| 1. S. J. Ball | 19. M. W. Kohring |
| 2. T. W. Burwinkle | 20. D. L. Laughlin |
| 3. G. H. Coleman | 21. D. M. McGinty |
| 4. K. W. Cook | 22. D. L. Moses |
| 5. W. A. Duggins | 23. K. H. Poteet |
| 6. M. B. Farrar | 24. R. T. Primm, III |
| 7. R. E. Fenstermaker | 25. J. A. Ray |
| 8. W. Fulkerson | 26. J. B. Richard |
| 9. M. K. Ford | 27. G. R. Smolen |
| 10. H. A. Glovier | 28. R. L. Stover |
| 11. G. M. Goodwin | 29. D. B. Trauger |
| 12. R. W. Hobbs | 30. K. W. West |
| 13. S. A. Hodge | 31. RRD Document Control Center |
| 14. S. S. Hurt | 32-33. Laboratory Records Department |
| 15. E. B. Johnson | 34. Laboratory Records, ORNL, RC |
| 16. H. R. Kerchner | 35-36. Central Research Library |
| 17. H. T. Kerr | 37. Document Reference Section |
| 18. W. E. Kohn | 38. ORNL Reference Section |

EXTERNAL DISTRIBUTION

39. N. Goldenberg, Director, Safety, QA, and Safeguards, Office of Support Programs, Department of Energy, Germantown, Maryland, 20545.
40. Dr. Robert Neuhold, Director, Division of Energy Research Reactors Operations, NE-473; F-426A/GTN, 19901 Germantown Road, Germantown, Maryland, 20545
41. J. N. Maddox, ER73, Mail Stop G226 GTN, Office of Health and Environmental Research, Office of Energy Research, Department of Energy, Washington, D.C., 20545.
42. L. E. Temple, Director, Construction Management, Office of Energy Research, Department of Energy, Washington, D.C., 20585.
43. Safety and Environmental Control Division, Department of Energy, Oak Ridge, Tennessee, 37831.
44. Office of Assistant Manager for Energy Research and Development, Department of Energy, Oak Ridge Operations Office, Oak Ridge, Tennessee, 37831.
45. Donald K. Stevens, Associate Director, Office of Basic Energy Sciences, ER11, J304/GTN, 19901 Germantown Road, Germantown, Maryland 20545
- 46-47. Office of Scientific and Technical Information, DOE, Oak Ridge, Tennessee, 37831.